


24" 23/32 APA RATED SHEATHING BOTH SIDES
w/ 8d COMMON @ 6" c/c TOP AND BOTTOM 3
ROWS 16d @ 6" c/c TO FILLER BLOCK

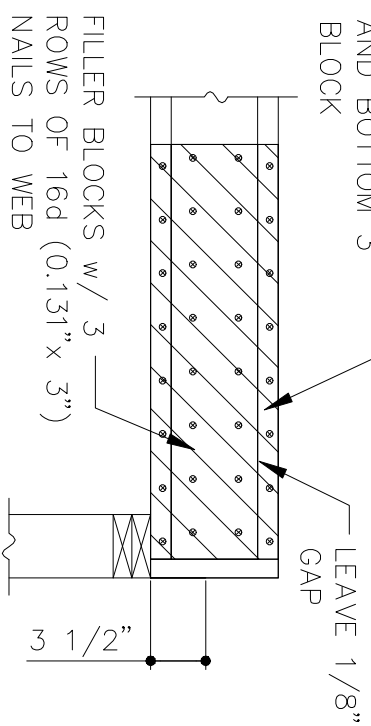


ALL GLUED AND NAILED

REPAIR DETAIL FOR LARGE
HOLE IN WEB NEAR
BEARING

NOTE:
DAMAGE TO I-JOIST FLANGE
AND/OR WEB CAN CAUSE
FAILURE OF FLOOR SYSTEM.
SPAN, SPACING AND LOADING AS
WELL AS EXTENT AND LOCATION
OF DAMAGE ALL AFFECT THE
REPAIR REQUIRED.

EACH CASE SHALL BE REVIEWED.

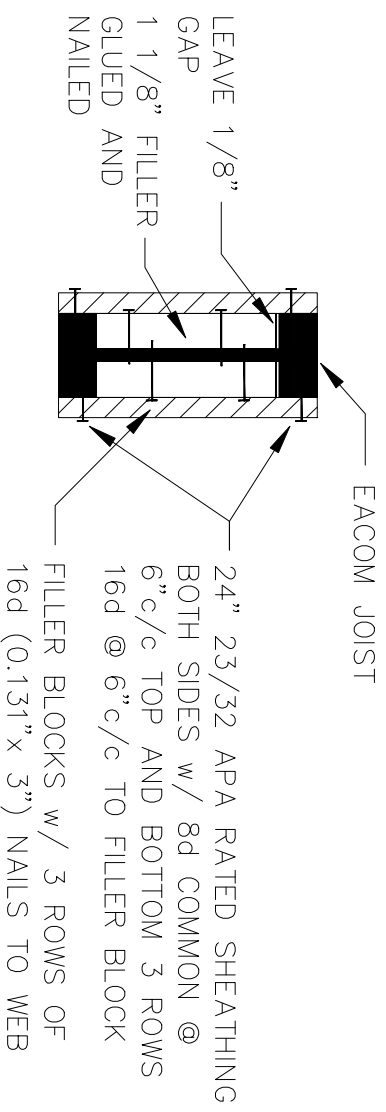

TYPICAL REPAIR DETAIL "D"

P3 BY EACOM
TYPICAL REPAIR DETAILS