


ALL GLUED AND NAILED

REPAIR DETAIL FOR TOP FLANGE NOTC, 50% DAMAGE TO FLANGE, AT CENTER SPAN OF JOISTS

NOTE:
 DAMAGE TO I-JOIST FLANGE AND/OR WEB CAN CAUSE FAILURE OF FLOOR SYSTEM. SPAN, SPACING AND LOADING AS WELL AS EXTENT AND LOCATION OF DAMAGE ALL AFFECT THE REPAIR REQUIRED.
 EACH CASE SHALL BE REVIEWED.

ATTACH 8'-0" LONG LVL ON EITHER SIDE GLUED AND NAILED w/ 16d SINKER @ 6" c/c TO TOP AND BOTTOM FLANGES

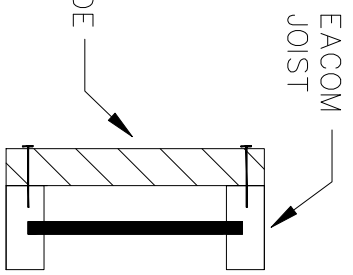

TYPICAL REPAIR DETAIL "E"

P3 BY EACOM
 TYPICAL REPAIR DETAILS